

Accessories

Dew-point Monitor (portable)



Models with optional portable dew-point monitor is convenient to test dew-point temperature of different machines.

Function	Specification		
Display	Digital and Real-time Curve Display supports English\Chinese\Japanese\Korean version.		
Range	-50+50℃ td		
	Pressure	-0.11.5MPa td	
	Temperature	-30+50℃	
Accuracy	Dew point	±2℃ td@-50℃ td	
	Pressure	±0.005MPa	
	Temperature	±0.3℃	
	Condition	Temp.: 23℃±3℃ Humidity: <90% no condensation	
Other Units	g/m³,mg/m³,ppmv,g/kg		
Data Record	Memory space	4G,data can be exported by memory card	
	Number of files	≤512 files	
	Medium	SD card	

High Efficiency Particulate Absorbing Filter HEPA(0.3µm)



Optical Material Tank (3µm)



For optical model, These two devices are optional to ensure no material contamination.


Optical Powder-removing Hopper



Optical SCD-OP series together with powder- removing hopper which can help avoid powder in the materials; all material contact surfaces are stainless steel mirror polished.




Oil Filter

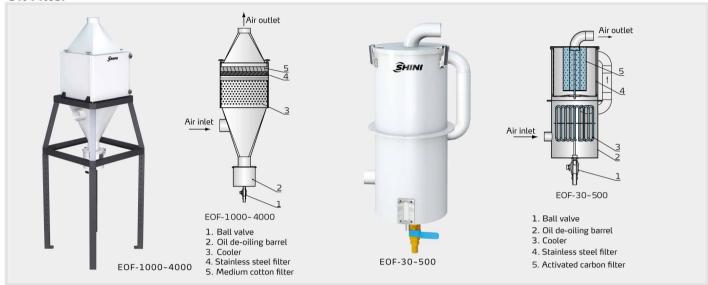

Oil filter is optional to filter the oil substance in return air for honeycomb protection.

Model	Applied to	Cooling water flow (L/min)	Cooling water temperature(°C)
EOF-30-50	SD-40H~120H SDD-40U/40H~80U/40H SCD-40U/40H~80U/40H	5	
EOF-30-63	SDD-120U/80H~160U/120H SCD-120U/80H~160U/120H	5	
EOF-30-76	SDD-230H/120H SCD-230U/120H	5	
EOF-150	SD-200H SDD-300U/200H~450U/200H SCD-300U/200H~450U/200H	10	
EOF-300	SD-400H SDD-600U/400H~750U/400H SCD-600U/400H~750U/400H	20	7~15
EOF-500	SD-700H SDD-900U/700H~1200U/700H SCD-900U/700H~1200U/700H	30	/~15
EOF-1000	SD-1000H	65	
EOF-2000	SD-1500H SD-2000H	130	
EOF-3000	SD-3000H	185	
EOF-4000	SD-4000H	245	

Cyclone Dust Collector

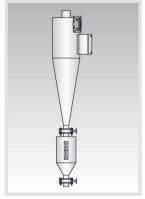

ACF-5"~12"



ACF-3"-4"

Cyclone dust collector is used to collect the dust in return air.

Model	Applied to	
ACF-3"	SD-300H / 400H	
ACF-4"	SD-700H	
ACF-5"	SD-1000H	
ACF-8"	SD-1500H/2000H/3000H	
ACF-12"	SD-4000H	

Shini Group

Addr: No. 23, Minhe St., Shulin Dist., New Taipei, Taiwan

Tel: +886 2 2680 9119

Fax: +886 2 2680 9229

Email: shini@shini.com

Factories:

- Taiwan
- Dongguan
- Pinghu
- Ningbo
- Chongqing
- Pune